Washing station PROWASH CA PISTOPLAV


Service / Site : QUAL / France : 0012 : V.03.1 Référence


: 19/02/2016 : 1/9 Date version Page

Version


USER GUIDE




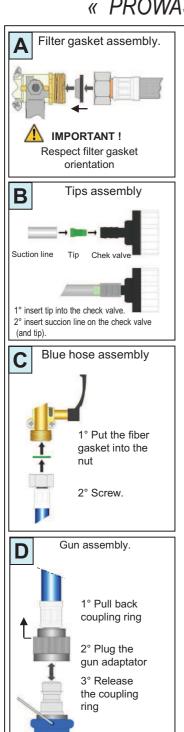

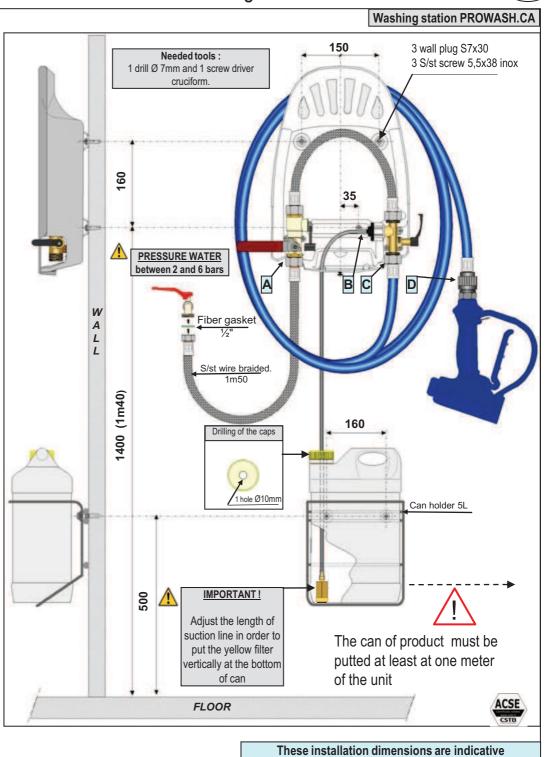

PACKING LIST - PROWASH UNIT 1 Hygiene Unit PROWASH (1 or 2 products) 1 connection kit 1(2) Suction line L=2m. 1Stainless steel wire braided hose. F1/2 - F3/4 L= 1,5m 1(2) Foot filter with weight. 1 Discharge hose with conneciton L= 10, 15, 20 or 25 m (depends on modell) 1(2) Bag with 15 metering tips. 1Blue Spray gun 1 Green injector. 1 or 2 can holders 5 litres (depends on modell) 1 kit with screw and o'rings. 1Strainer washer 3/4". 1Technical data sheet 2 fibre gaskets 1/2". Dimensions of the box (LxIxh): 450 x 390 x 290 mm 2 fibre gaskets 3/4". Weight unit (hose 10 m) = 7 Kg 5 (7) st/st screws. Ø 5,5 x 37. Weight unit (hose 15m) = 8,3 Kg 5(7) Plastic plug type: S7. Weight unit (hose 20m) = 9,5 Kg 2 (4) st/st washer type: L5 Weight unit (hose 25m) = 10,5 Kg ACSE CSTB

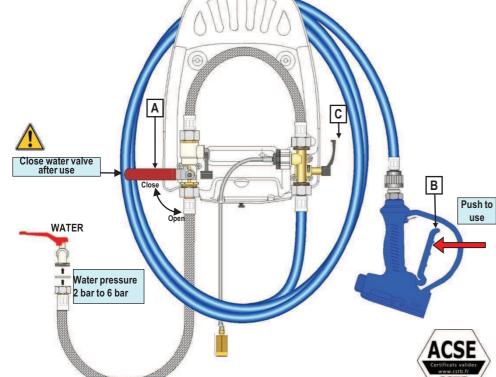

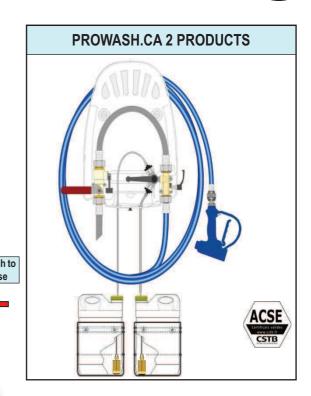




USE

- 1) Open water inlet valve "A"
- 2) Put down handle "C" to select "WASHING" mode.
- 3) Choose between product 1 or 2 (only with 2 products unit).
- 4) Push on gun trigger "B".
- 5) Wait few second for filling the succion line.
- 6) Spray.
- 7) Put up handle "C" on "RINSING" mode.
- 8) Rinse.
- 9) Shut-off water inlet valve "A" after use.



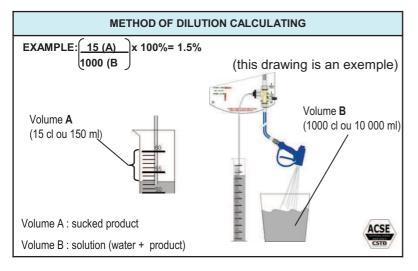

CAUTION

ALWAYS orientate spray in direction of surfaces to treat.

NEVER orientate spray in direction of people, animals or plants

ALWAYS wait few seconds for a good product and water mixing.

ALWATO Walk low Seconds for a good product and water fin

ALWAYS close water inlet valve after each use.

WATER PRESSURE must be included on 2 bar to 6 bar.

MAXIMUM working temperature is 50°C

ALWAYS keep the unit on frost protection

Dilution table for "PROWASH" unit					
Pink	0,50%	Blue	5,00%		
Purple	0,80%	White	6,80%		
Turquoise	1,00%	Red	8,60%		
Yellow	1,80%	beige	10,50%		
Dark brown	1,50%	Black	10,80%		
Orange	2,60%	Grey	10,90%		
Green	3,20%	Without tip	11,00%		
Brown light	3,30%	Transparent			


This table is done to help you to choose a tip according to expected concentration.


Conditions tests:

20m hose + blue gun

Green venturi injector

Dynamic water pressure = 3 bars (cold water)

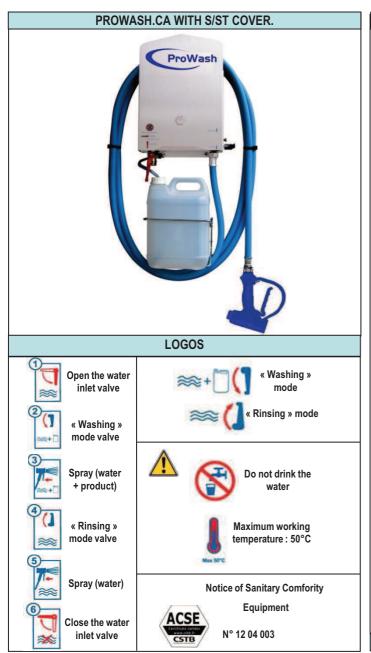

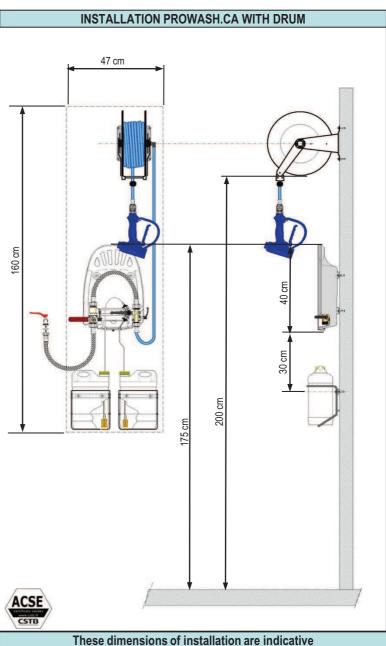

TROUBLES


The unit doesn't suck up product


- 1°_ Check if water pressure is ok (minimum : 2 bars, maximum : 6 bars)
- 2°_ Check if filter gasket is clean. (clean or replace)
- 3° _ Check if the succion line is correctly in the can, and if pipe is not bended or blocked
- 4°_ Check if tip is not blocked (clean or replace)
- 5°_ Check if yellow filter is clean (clean or replace)
- 6°_ Check if spraying gun is clean (clean or replace)


Can product fills with water.


7°_ Check if check-valve is clean (clean or replace)




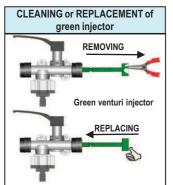

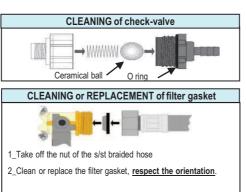

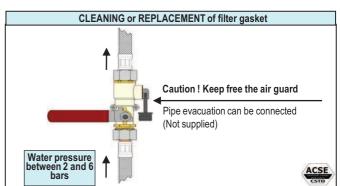

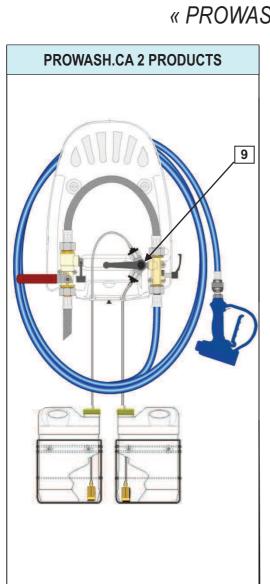

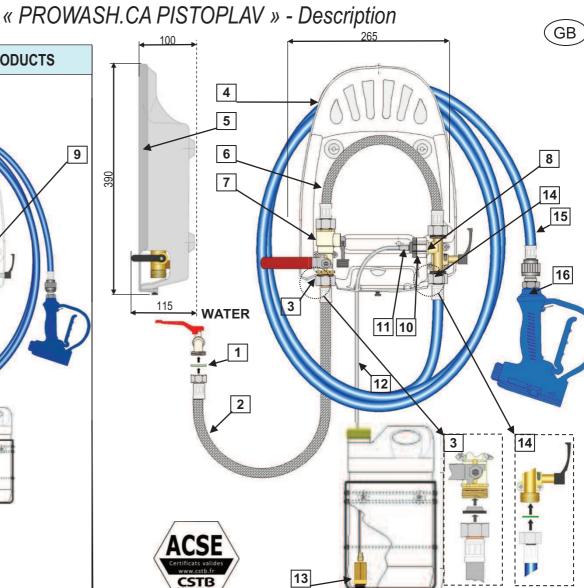

PROWASH unit is manufactured for cleaning and disinfection of floors and surfaces.

/	CST	В	/	
	7800.0	=/		ı

ACCESSORIES ANS SPARE PARTS PROWASH.CA			
Designation			
Fiber gasket 1/2"	1		
S/ST Braided hose F1/2 x F3/4 Lg: 1,5m	2		
Filter gasket 3/4"	3		
Back plate for unit 1 or 2 products (PVC)	4		
Screen printed cover 1 Product (PVC)			
Screen printed cover 2 Product (PVC)	5		
S/St Wire braided hose FF 3/4 L: 0,4 m	6		
Ball valve CA elbow air guard			
Venturi 1p+check valve+green injector+gasket EPDM			
Venturi 2p+check valve+green injector+gasket EPDM			
Check valve (EPDM)			
Dilution tip (bag of 15pieces)	11		
suction line Lg: 2m	12		
Yellow filter with integrated weight			
Fiber gasket 3/4"			
10m, 15m, 20m or 25m blue hose equipped			
Equipped blue gun with quick coupler			

N° DE CERTIFICAT	ACSE	
Prowash CA Unit	12/04-003	



